

Manual connection WEMA to MotoMonitor

Probe with build in resistor 1,3K Ohm:


If sensor has 3 inputs (black, red, blue):

Blue wire - ground,


Red wire – power,

Black wire – sensor signal,

Kolor przewodu	MotoMonitor
Red wire	Pin 5
Black wire	Pin 6
Blue wire	Pin 7

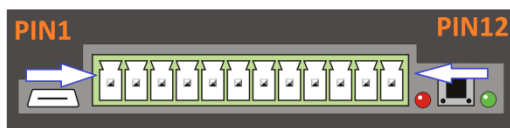

Wema probe without resistor 1,3K Ohm:

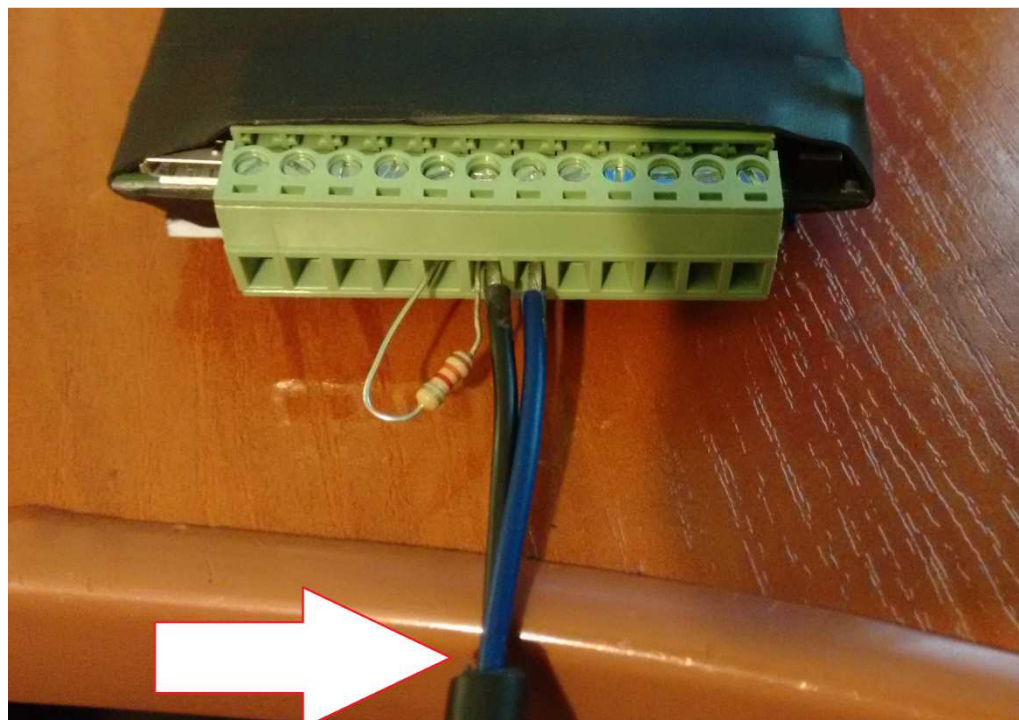

Wire color	MotoMonitor
Resistor 1,3 k Ohm	Pin 5
Black wire + Resistor 1,3kOhm	Pin 6
Blue wire	Pin 7

MotoMonitor:

Resistor have to be connected between pin 5 and 6

**To set Wema meter properly go to MOTOMONITOR -> SETTINGS -> SYSTEM -> FUEL INPUT
SETTINGS -> FUEL INPUT IS WEMA**